

TEXAS OFFICIAL WOOD DESTROYING INSECT REPORT

Page 1 of 2

4200 WINDWOOD RD.

Inspected Address

AUSTIN

City

78722

Zip Code

SCOPE OF INSPECTION

- A. This inspection covers only the multi-family structure, primary dwelling or place of business. Sheds, detached garages, lean-tos, fences, guest houses or any other structure will not be included in this inspection report unless specifically noted in Section 5 of this report.
- B. This inspection is limited to those parts of the structure(s) that are visible and accessible at the time of the inspection. Examples of inaccessible areas include but are not limited to (1) areas concealed by wall coverings, furniture, equipment and stored articles and (2) any portion of the structure in which inspection would necessitate removing or defacing any part of the structure(s) (including the surface appearance of the structure). **Inspection does not cover any condition or damage which was not visible in or on the structure(s) at time of inspection but which may be revealed in the course of repair or replacement work.**
- C. Due to the characteristics and behavior of various wood destroying insects, it may not always be possible to determine the presence of infestation without defacing or removing parts of the structure being inspected. Previous damage to trim, wall surface, etc., is frequently repaired prior to the inspection with putty, spackling, tape or other decorative devices. Damage that has been concealed or repaired may not be visible except by defacing the surface appearance. **The WDI inspecting company cannot guarantee or determine that work performed by a previous pest control company, as indicated by visual evidence of previous treatment; has rendered the pest(s) inactive.**
- D. If visible evidence of active or previous infestation of listed wood destroying insects is reported, it should be assumed that some degree of damage is present.
- E. If visible evidence is reported, it does not imply that damage should be repaired or replaced. Inspectors of the inspection company usually are not engineers or builders qualified to give an opinion regarding the degree of structural damage. Evaluation of damage and any corrective action should be performed by a qualified expert.
- F. **THIS IS NOT A STRUCTURAL DAMAGE REPORT OR A WARRANTY AS TO THE ABSENCE OF WOOD DESTROYING INSECTS.**
- G. If termite treatment (including pesticides, baits or other methods) has been recommended, the treating company must provide a diagram of the structure(s) inspected and proposed for treatment, label of pesticides to be used and complete details of warranty (if any). At a minimum, the warranty must specify which areas of the structure(s) are covered by warranty, renewal options and approval by a certified applicator in the termite category. Information regarding treatment and any warranties should be provided by the party contracting for such services to any prospective buyers of the property. The inspecting company has no duty to provide such information to any person other than the contracting party.
- H. There are a variety of termite control options offered by pest control companies. These options will vary in cost, efficacy, areas treated, warranties, treatment techniques and renewal options.
- I. There are some specific guidelines as to when it is appropriate for corrective treatment to be recommended. Corrective treatment may only be recommended if (1) there is visible evidence of an active infestation in or on the structure, (2) there is visible evidence of a previous infestation with no evidence of a prior treatment.
- J. If treatment is recommended based solely on the presence of conducive conditions, a preventive treatment or correction of conducive conditions may be recommended. The buyer and seller should be aware that there may be a variety of different strategies to correct the conducive condition(s). These corrective measures can vary greatly in cost and effectiveness and may or may not require the services of a licensed pest control operator. There may be instances where the inspector will recommend correction of the conducive conditions by either mechanical alteration or cultural changes. Mechanical alteration may be in some instances the most economical method to correct conducive conditions. If this inspection report recommends any type of treatment and you have any questions about this, you may contact the inspector involved, another licensed pest control operator for a second opinion, and/or the Structural Pest Control Service of the Texas Department of Agriculture.

1A. TEXAS INSPECTION SERVICE OF AUSTIN INC. 1B. 3945
Name of Inspection Company SPCS Business License Number

1C. PO Box 44585 AUSTIN TX. 78765 512-477-7044
Address of Inspection Company City State Zip Telephone No.

1D. JIM EMMON 1E. Certified Applicator ☒ (check one)
Name of Inspector (Please Print) Technician ☐

2. NA 3. 9/5/18
Case Number (VA/FHA/Other) Inspection Date

4A. SMITH Seller ☐ Agent ☐ Buyer ☒ Management Co. ☐ Other ☐
Name of Person Purchasing Inspection

4B. ESIAE
Owner/Seller

4C. REPORT FORWARDED TO: Title Company or Mortgagee ☐ Purchaser of Service ☐ Seller ☐ Agent ☒ Buyer ☒
(Under the Structural Pest Control regulations only the purchaser of the service is required to receive a copy)

The structure(s) listed below were inspected in accordance with the official inspection procedures adopted by the Texas Department of Agriculture Structural Pest Control Service. This report is made subject to the conditions listed under the Scope of Inspection. A diagram must be attached including all structures inspected.

5. HOUSE ONLY
List structure(s) inspected that may include residence, detached garages and other structures on the property. (Refer to Part A, Scope of Inspection)

6A. Were any areas of the property obstructed or inaccessible? Yes ☒ No ☐
(Refer to Part B & C, Scope of Inspection) If "Yes" specify in 6B.

6B. The obstructed or inaccessible areas include but are not limited to the following:

Attic ☐	Insulated area of attic ☒	Plumbing Areas ☒	Planter box abutting structure ☐
Deck ☒	Sub Floors ☒	Slab Joints ☒	Crawl Space ☐
Soil Grade Too High ☒	Heavy Foliage ☐	Eaves ☒	Weepholes ☐

Other ☐ Specify: _____

7A. Conditions conducive to wood destroying insect infestation: Yes ☒ No ☐
(Refer to Part J, Scope of Inspection) If "Yes" specify in 7B.

7B. Conducive Conditions include but are not limited to:

Debris under or around structure (K) ☒	Wood to Ground Contact (G) ☒	Formboards left in place (I) ☒	Excessive Moisture (J) ☒
Planter box abutting structure (O) ☒	Footing too low or soil line too high (L) ☒	Wood Rot (M) ☒	Heavy Foliage (N) ☒
Insufficient ventilation (T) ☐	Wood Pile in Contact with Structure (Q) ☐	Wooden Fence in Contact with the Structure (R) ☐	

Other (C) ☐ Specify: _____

8. Inspection Reveals Visible Evidence in or on the structure:

	Active Infestation	Previous Infestation	Previous Treatment
8A. Subterranean Termites	Yes ☒ No ☐	Yes ☒ No ☐	Yes ☐ No ☒
8B. Drywood Termites	Yes ☐ No ☒	Yes ☐ No ☒	Yes ☐ No ☒
8C. Formosan Termites	Yes ☐ No ☒	Yes ☐ No ☒	Yes ☐ No ☒
8D. Carpenter Ants	Yes ☐ No ☒	Yes ☐ No ☒	Yes ☐ No ☒
8E. Other Wood Destroying Insects	Yes ☐ No ☒	Yes ☐ No ☒	Yes ☐ No ☒

Specify: _____

8F. Explanation of signs of previous treatment (including pesticides, baits, existing treatment stickers or other methods) identified: _____

8G. Visible evidence of: SUB. TERMITES has been observed in the following areas: PREVIOUS - RIGHT REAR STORAGE ROOM SILL, W/ FLOOR, UNDER FIREPLACE. ACTIVE - UNDER REAR LIVING ROOM AT A PIER, S/ UNDER THE FIREPLACE
If there is visible evidence of active or previous infestation, it must be noted. The type of insect(s) must be listed in the first blank and all identified infested areas of the property inspected must be noted in the second blank. (Refer to Part D, E & F, Scope of Inspection)

Licensed and Regulated by the Texas Department of Agriculture
PO Box 12847, Austin, Texas 78711-2847
Phone 866-918-4481 Fax 888-232-2567

SPCS/T-4 (Rev. 09/01/07)

Buyer's Initials _____

Page 2 of 2

Yes ☐ No ☒

If "Yes," specify corrections:

Yes ☒ No ☐

Yes ☒ No ☐

Specify reason: CONCRETE SOIL AT THE SCARS, PUT THE TREES AWAY ELIOT WIFE WOOD/GROUND
Refer to Scope of Inspection Part J CONTRACT. READ WILHELM HOUSE FOR SUB. TERTILES - OBTAIN A RENEWABLE

Other ☐

Limited


Name of Pesticide, Bait or Other Method

Yes ☐ No ☐ List Insects:

If "Yes", copy(ies) of warranty and treatment diagram must be attached.

The inspector must draw a diagram including approximate perimeter measurements and indicate active or previous infestation and type of insect by using the following codes: E-Evidence of Infestation, A-Active; P-Previous; D-Drywood Termites; S-Subterranean Termites; F-Formosan Termites; C-Conducive Conditions; B-Wood Boring Beetles;

H-Carpenter Ants; Other(s) – Specify _____

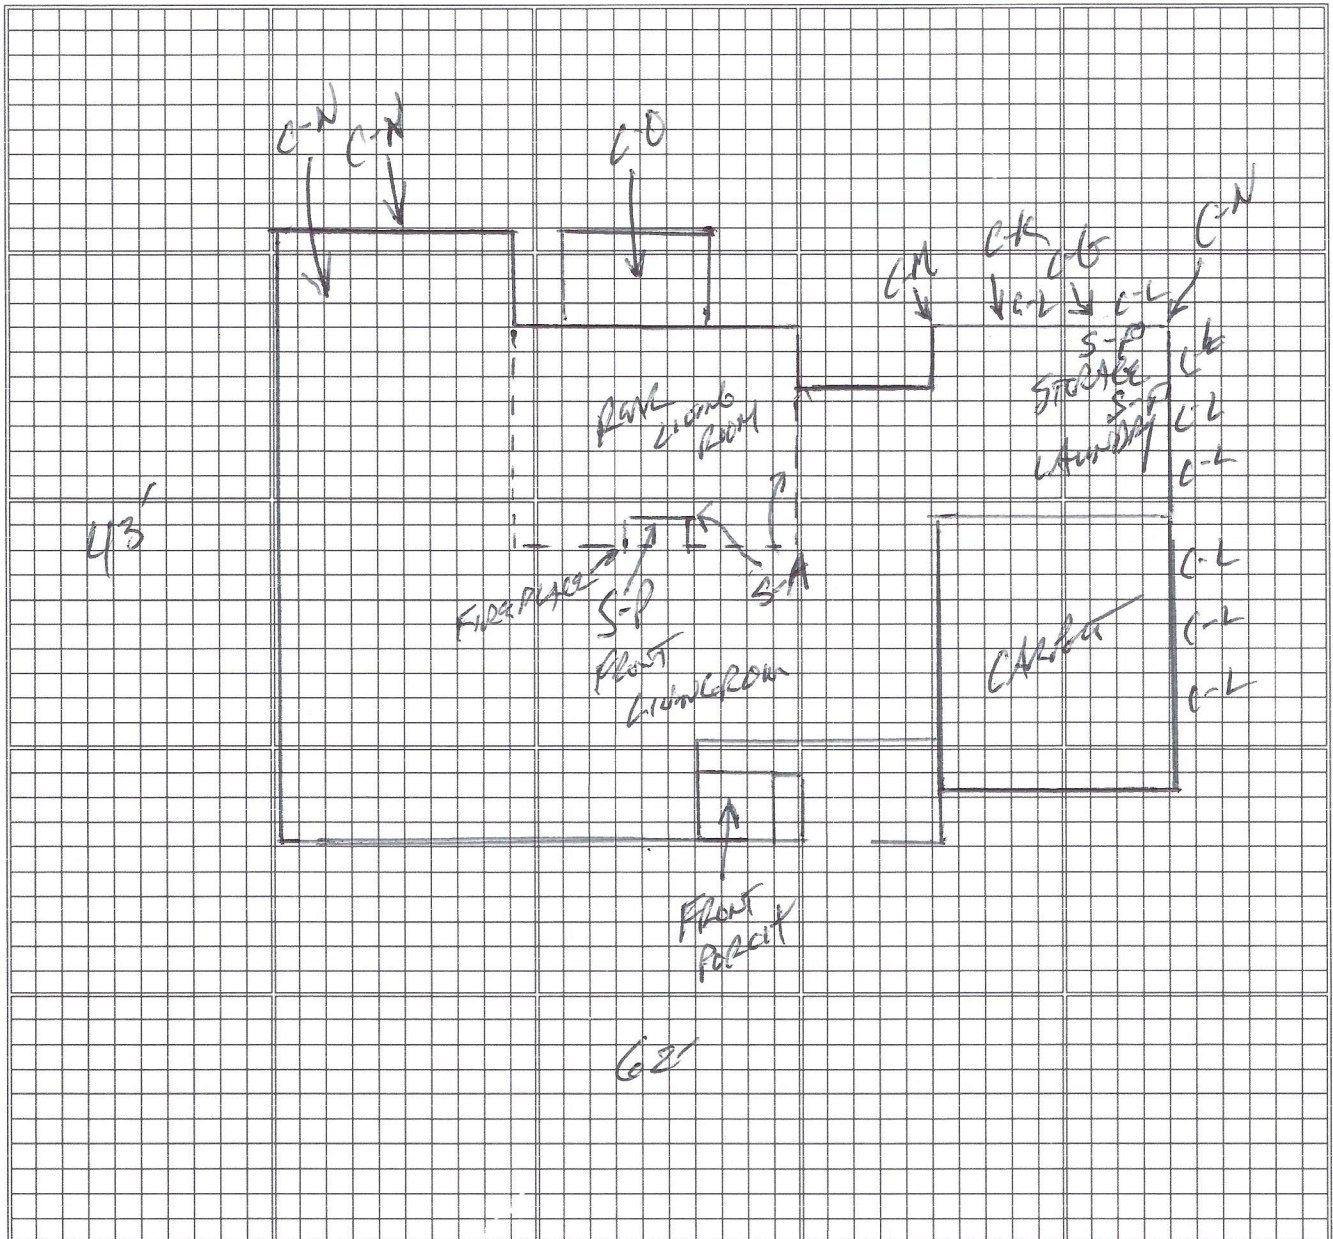

Additional Comments

Neither I nor the company for which I am acting have had, presently have, or contemplate having any interest in the property. I do further state that neither I nor the company for which I am acting is associated in any way with any party to this transaction.

Certified Applicator and Certified Applicator License Number

Electric Breaker Box ☐

Water Heater Closet ☐

Bath Trap Access ☐

Beneath the Kitchen Sink ☒

12B. Date Posted 9/5/8
Date

I have received the original or a legible copy of this form. I have read and understand any recommendations made. I have also read and understand the "Scope of Inspection." I understand that my inspector may provide additional information as an addendum to this report.

If additional information is attached, list number of pages:

Signature of Purchaser of Property or their Designee:

Date : _____